

Work Order ID 88859

88859

Page 1

August-08-12 11:29:58 AM

Item ID: D3121-045

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Bracket Assembly

Start Date: 08/08/2012 Start Qty: 5.00

5

Cust Item ID:

Required Date: 22/08/2012 Req'd Qty: 5.00

5

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/08/08 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool#	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	-------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3121

Rev E

100

0.00

100

BAND SAW

Bandsaw

Memo

0.00

Jeaspa Bandsaw

Cut (1) blank per D3121-15 Cut blanks (1.00" x 2.00") x 3.250" Long Bar

12/08/08 5 0

110

0.00

110

HAAS CNC VERTICAL MACHINING #1

HAAS 1

Memo

0.00

HAAS CNC vertical machine #1

Machine D3121-15 as per Folio FA325 and Dwg D3121 Debur Break all sharp edges 0.005 to 0.015 Scribe batch number to D3121-15 as per Dwg D3121

PO 12/08/11

21/ 12-08-00 85
4 1

120

0.00

120

QC2- Inspect parts off machine FAI/FAIB

QC

Memo

0.00

Quality Control

PO 12/08/11

21/ 12-08-10 85
4 1

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: Int Date: 12/08/13QA Closed: 150 Date: 12/8/14

Work Order: <u>88859</u>	DISPOSITION Rework <input type="checkbox"/> Scrap <input checked="" type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. <u>03121-15</u>		Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. <u>12-1685</u>		Machining <input checked="" type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling	✓ 12/08/11	110	1	TAP BROKE IN PART. Rec. Process	DAS 16 2-80 057012 17/08/13	Scrap + Desh no Repair	12/08/11 PD	DAS 15 2-80 17/08/13	DAS 15 2-80 057012 17/08/13
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input checked="" type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--	---

Work Order ID 88859

August-08-12 11:29:58 AM

88859

Page 2

Item ID: D3121-045

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Bracket Assembly

Start Date: 08/08/2012 Start Qty: 5.00

5

Cust Item ID:

Required Date: 22/08/2012 Req'd Qty: 5.00

5

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 *130* QC Quality Control	QC8- Inspect parts - second check Memo					4	0		
140 *140* Small Fab Small Fab	Small Fab Memo Assemble D3121-045 as per Dwg					4x			8/12/08/14
150 *150* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							(YU)



DAS
16
8-83 8/10/14

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											
FAULT CATEGORY																											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other																

Work Order ID 88859

August-08-12 11:29:58 AM

88859

Page 3

Item ID: D3121-045

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Bracket Assembly

Start Date: 08/08/2012 Start Qty: 5.00

5

Cust Item ID:

Required Date: 22/08/2012 Req'd Qty: 5.00

5

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

Identify as per dwg & Stock Location **235**

0.00

160

Packaging

Memo

0.00

Packaging

170

QC21- Final Inspection - Work Order Release

0.00

170

QC

Memo

0.00

Quality Control

MLJ 12/08/14

MLJ 12/08/14

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											
FAULT CATEGORY																											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other																		

Picklist Print

August-08-12 11:30:02 AM

Page 1

Work Order ID: 88859

88859

Parent Item: D3121-045

D3121-045

Parent Item Name: Bracket Assembly

Start Date: 08/08/2012

Required Date: 22/08/2012

Start Qty: 5.00

Required Qty: 5.00

Comments: IPP B02.01.27 Revised Steps 10-11KJ/JLM
IPP Rev:C ECN 1060 07-11-12 DD verified by: EC
IPP Rev:C New Dimensions for Blank Size 08-07-23 JLM Verified By:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D3121-241 *D3121-241* Bearing Assembly		Manufactured	No			100	Each	108.0000	2	10			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST235A		108							
				67280		3							
				84847		105							
D3121-21 *D3121-21* Bolt		Manufactured	No			140	Each	43.0000	2	10			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST235		43							
				66969		1							
				79732		4							
				85660		38							
M174B1.250X02.000 *M174B1 250X02 000* 17-4 SS Bar 1.250 x 2.00		Purchased	No			140	f	50.5250	0.2833	1.491053			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				MAT031		25.83							
				122244		25.83							
				MAT050		24.695							
				114899		2							
				115806		2.18							
				117483		9.9							
				121449		10.01							
				121769		0.605							

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																


Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY


Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

DART


DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 1 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2
A	02.04.15	NEW ISSUE	
B	03.01.16	ADD RIDGES; ADD MAT'L PROP; FIX P/N ADD -141/-143/-144/-145/-146	
C	04.02.17	ADD CLEARANCE; USE -241 BEARING	
D	06.05.17	D3121-25 CAP WAS 1.024, NOW 1.000	
E	07.11.07	ADD TOLERANCE TO 0.032 (DETAIL B)	

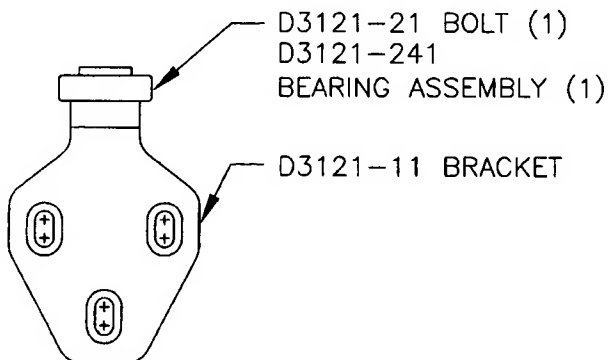RELEASED
07.11.07

D3121-041 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-33)

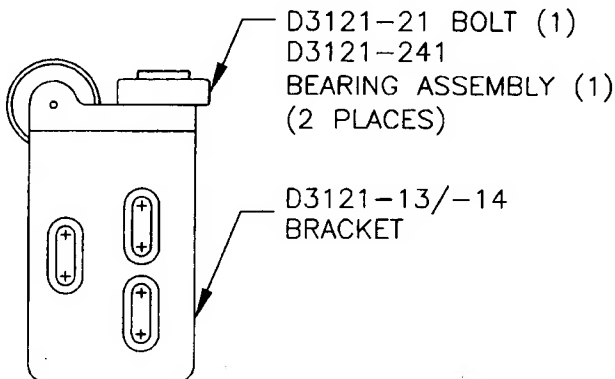

D3121-043 (SHOWN) / D3121-044 (OPPOSITE)
BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-37/-38)

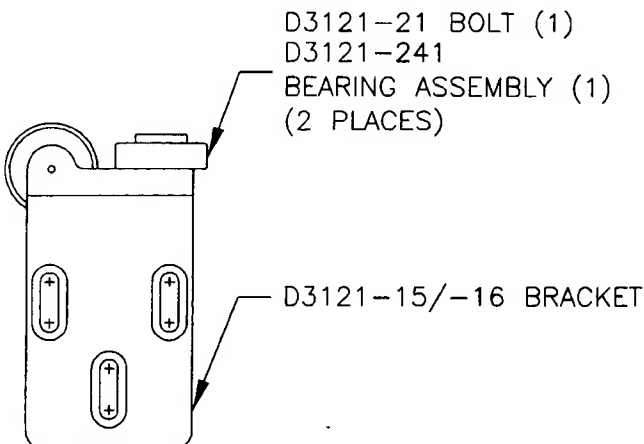

D3121-045 (SHOWN) / D3121-046 (OPPOSITE)
BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23000-35/-36)


SHOWN COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28859
12/28/08

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.




DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 2 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

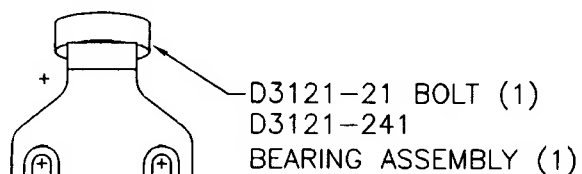

D3121-111 BRACKET


D3121-141 BRACKET ASSEMBLY
(REPLACES PREMIER P/N B30-23001-01)

RELEASED
07.11.07 W

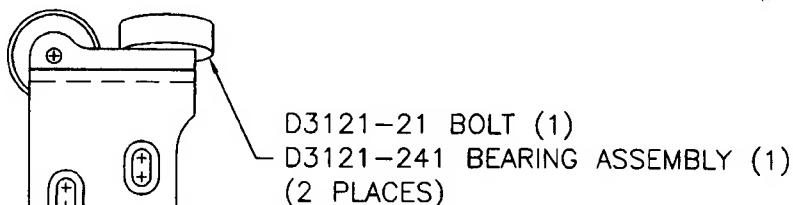

D3121-113/-114 BRACKET

**D3121-143 (SHOWN) / D3121-144 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-03/-04)

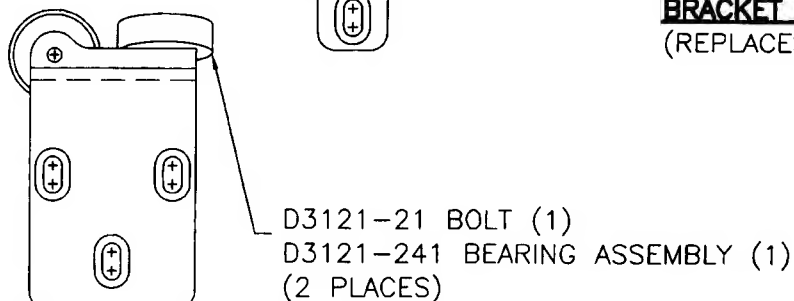

D3121-115/-116
BRACKET

**D3121-145 (SHOWN) / D3121-146 (OPPOSITE)
BRACKET ASSEMBLY**
(REPLACES PREMIER P/N B30-23000-05/-06)

07.11.07



Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DART

DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 3 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1


**DETAIL A:
SLOT DETAIL**
SCALE 2:1
VIEW ROTATED

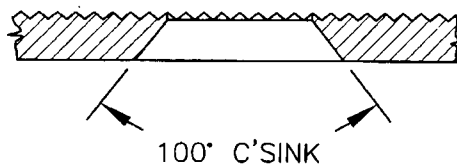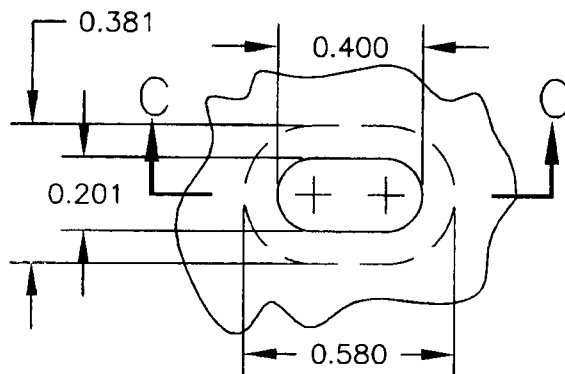

**SECTION
C-C**

RELEASED
07.11.07

**DETAIL B:
RIDGE DETAIL**
PARTIAL SECTION
SCALE 1:20

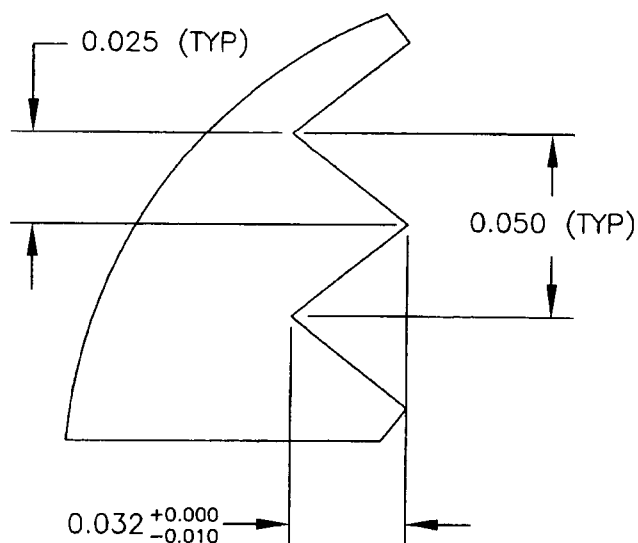


0805

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 4 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:1

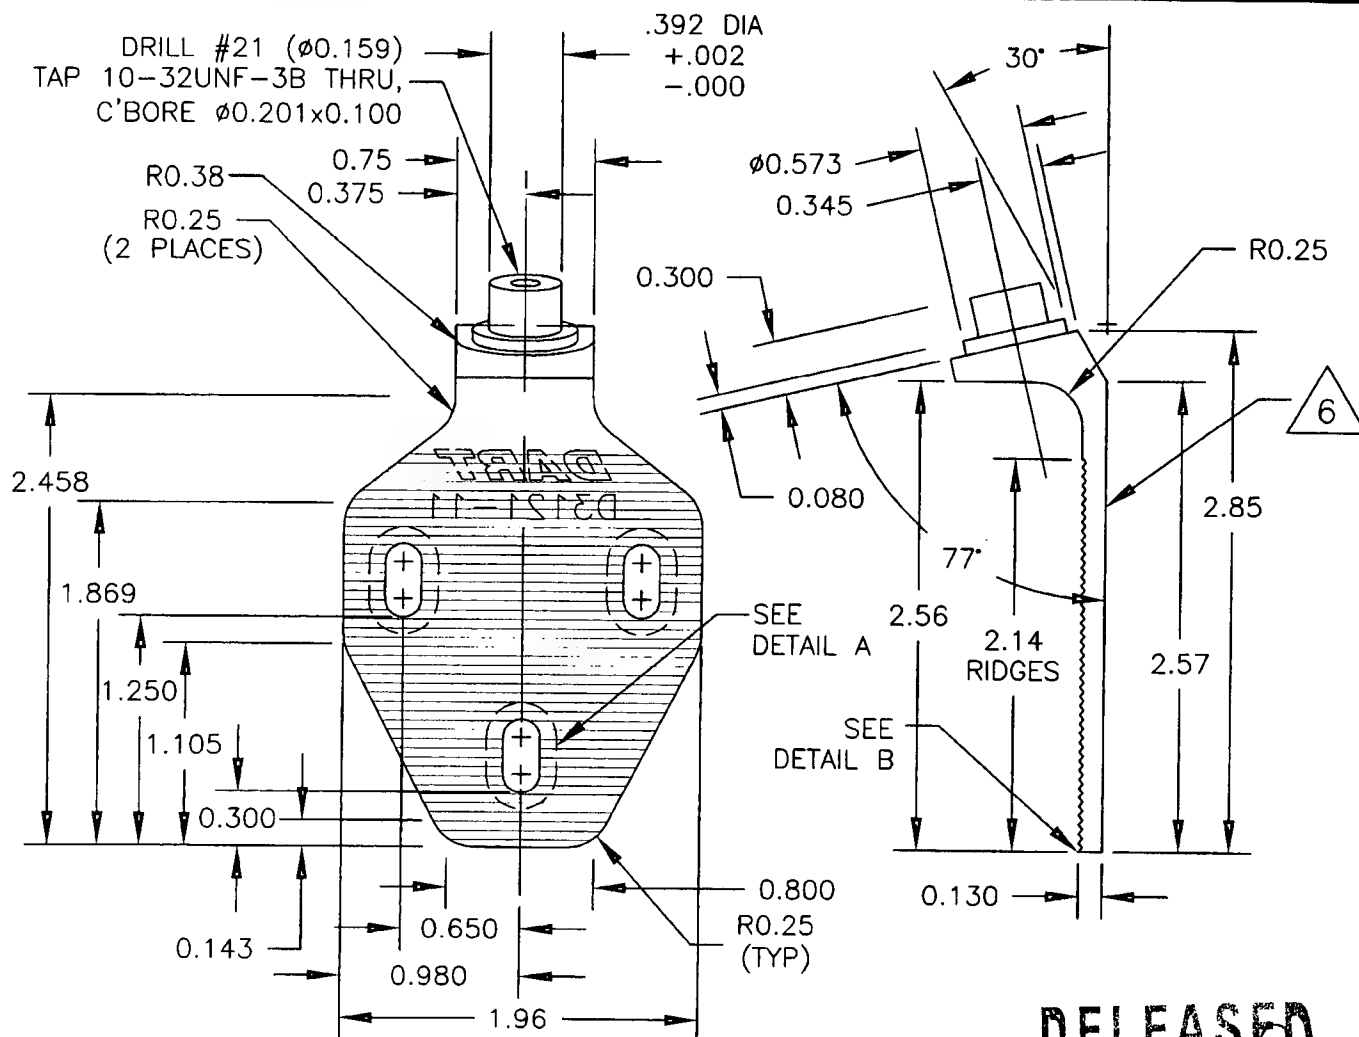

RELEASED
07.11.07

D3121-11 BRACKET

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2004 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #1	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #1	APPROVED #1	DRAWING NO. D3121	REV. E SHEET 5 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

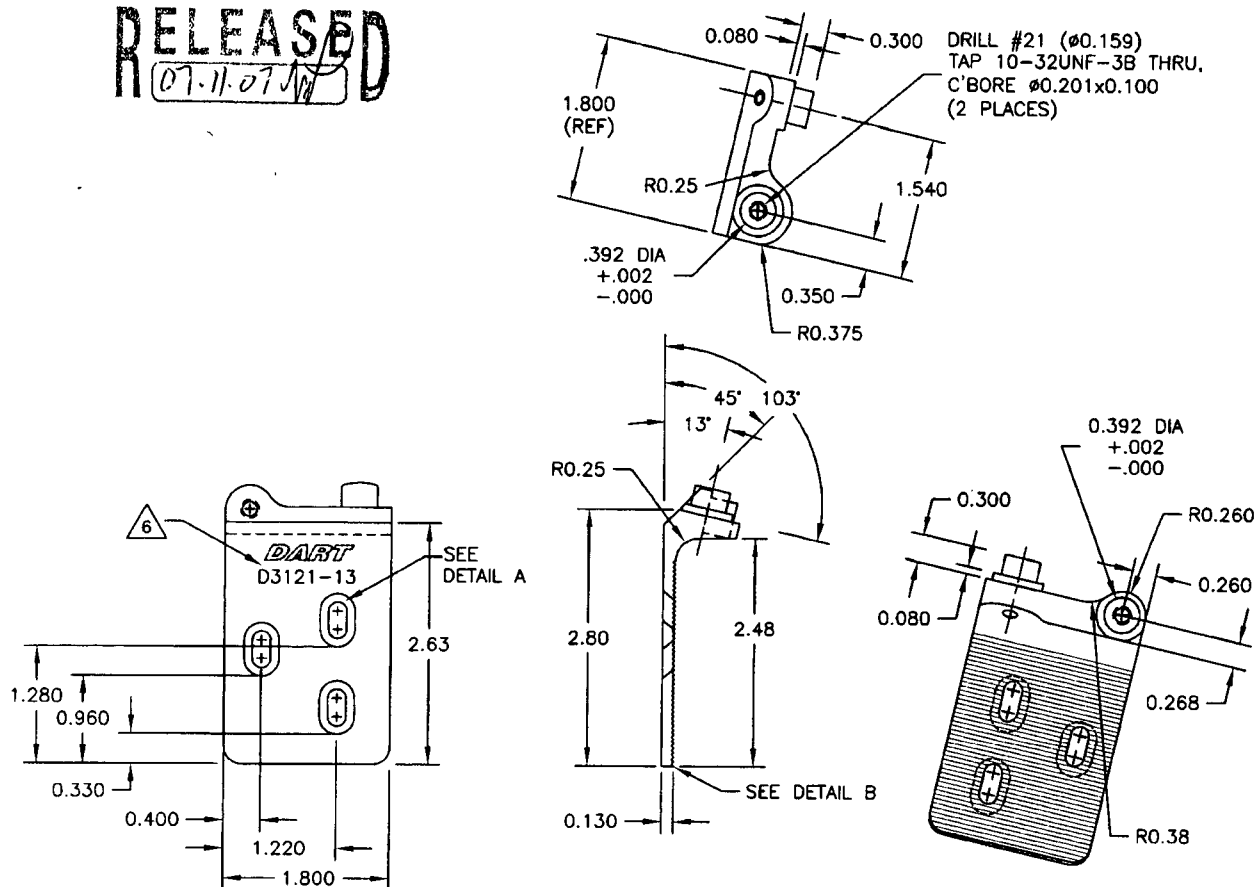

D3121-13 BRACKET (SHOWN)

D3121-14 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 5) ENGRAVE DART P/N & LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

98857


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 6 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

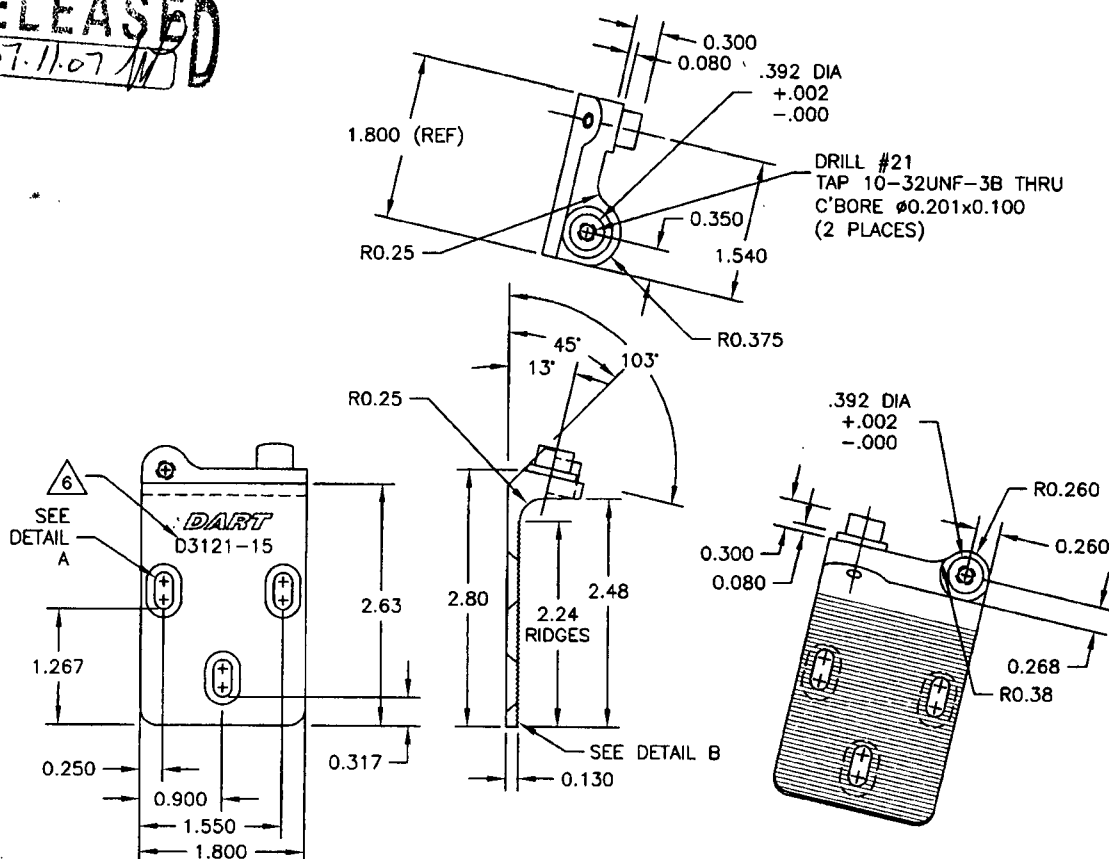

D3121-15 BRACKET (SHOWN)

D3121-16 BRACKET (OPPOSITE)

- 1) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES
- 4) BREAK ALL SHARP EDGES 0.005 TO 0.015.
- 5) ENGRAVE DART P/N AND LOGO AS SHOWN
- 6) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

0885


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #1	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #1	APPROVED #1	DRAWING NO. D3121	REV. E SHEET 7 OF 10
DATE 07.11.07	TITLE BRACKET ASSEMBLY		SCALE 1:2

RELEASED
07.11.07/W

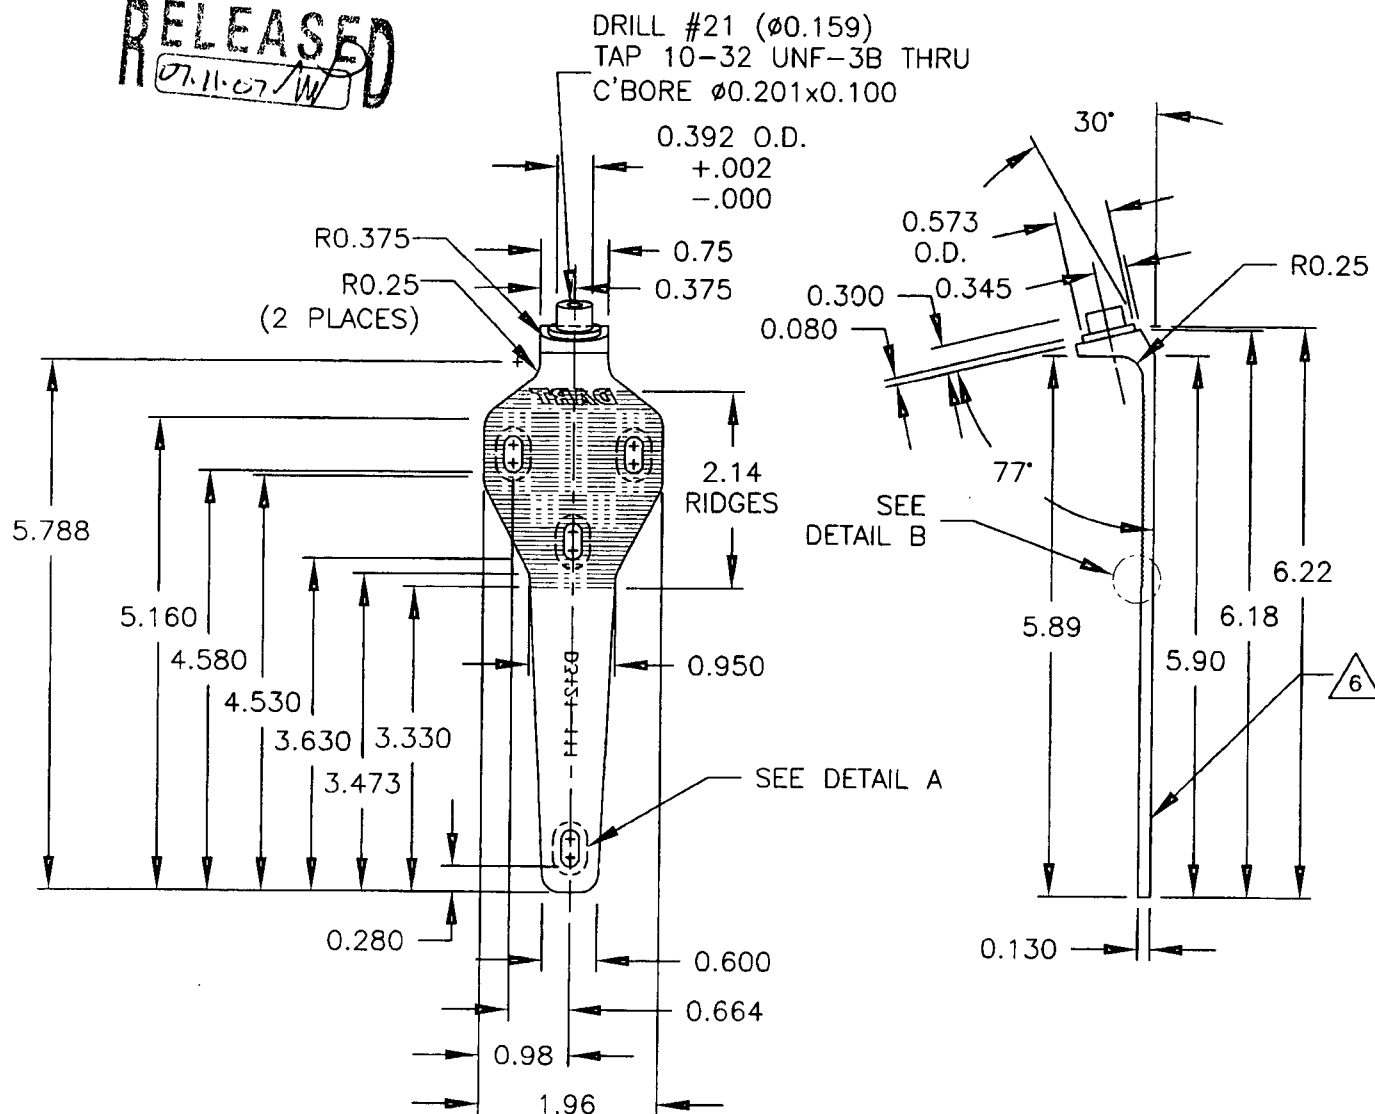

D3121-111 BRACKET

- 1) REPLACES PREMIER P/N B32-23001-11
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643 (REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE = 150 ksi
MIN YIELD TENSILE = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005

80055


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #1	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #1	APPROVED #1	DRAWING NO. D3121	REV. E SHEET 8 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

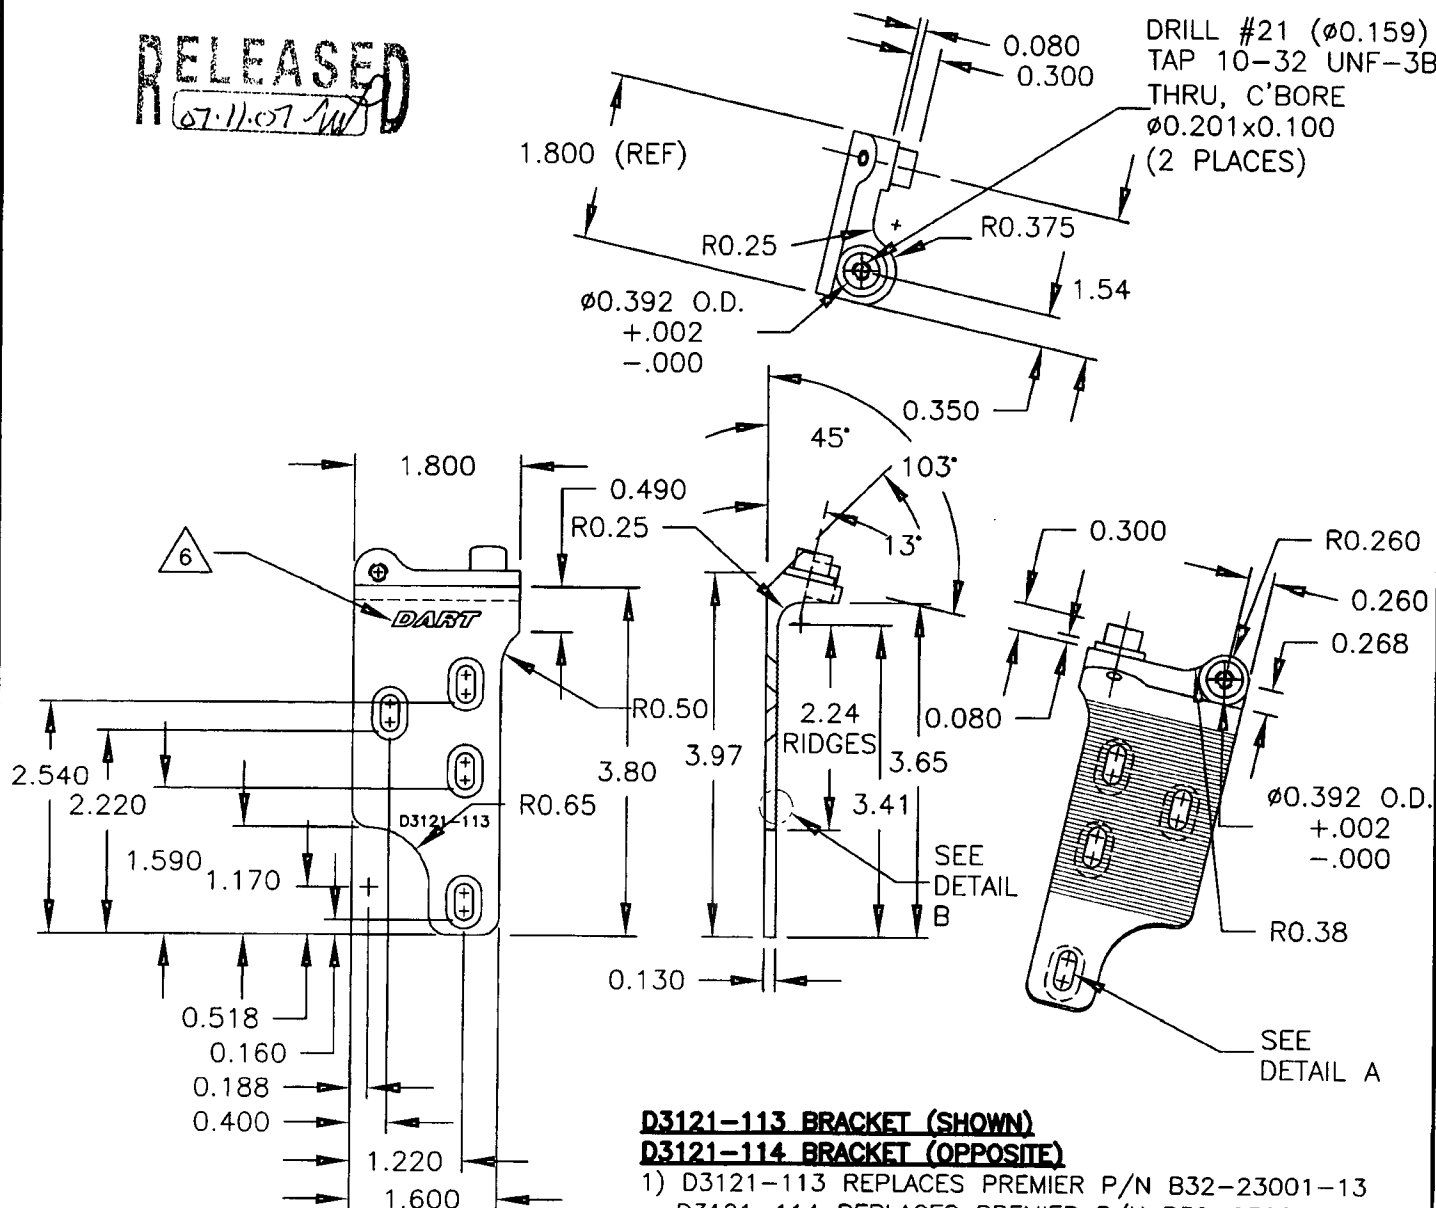

D3121-113 BRACKET (SHOWN)
D3121-114 BRACKET (OPPOSITE)

- 1) D3121-113 REPLACES PREMIER P/N B32-23001-13
D3121-114 REPLACES PREMIER P/N B32-23001-14
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 9 OF 10
DATE 07.11.07		TITLE BRACKET ASSEMBLY	SCALE 1:2

RELEASED
07.11.07

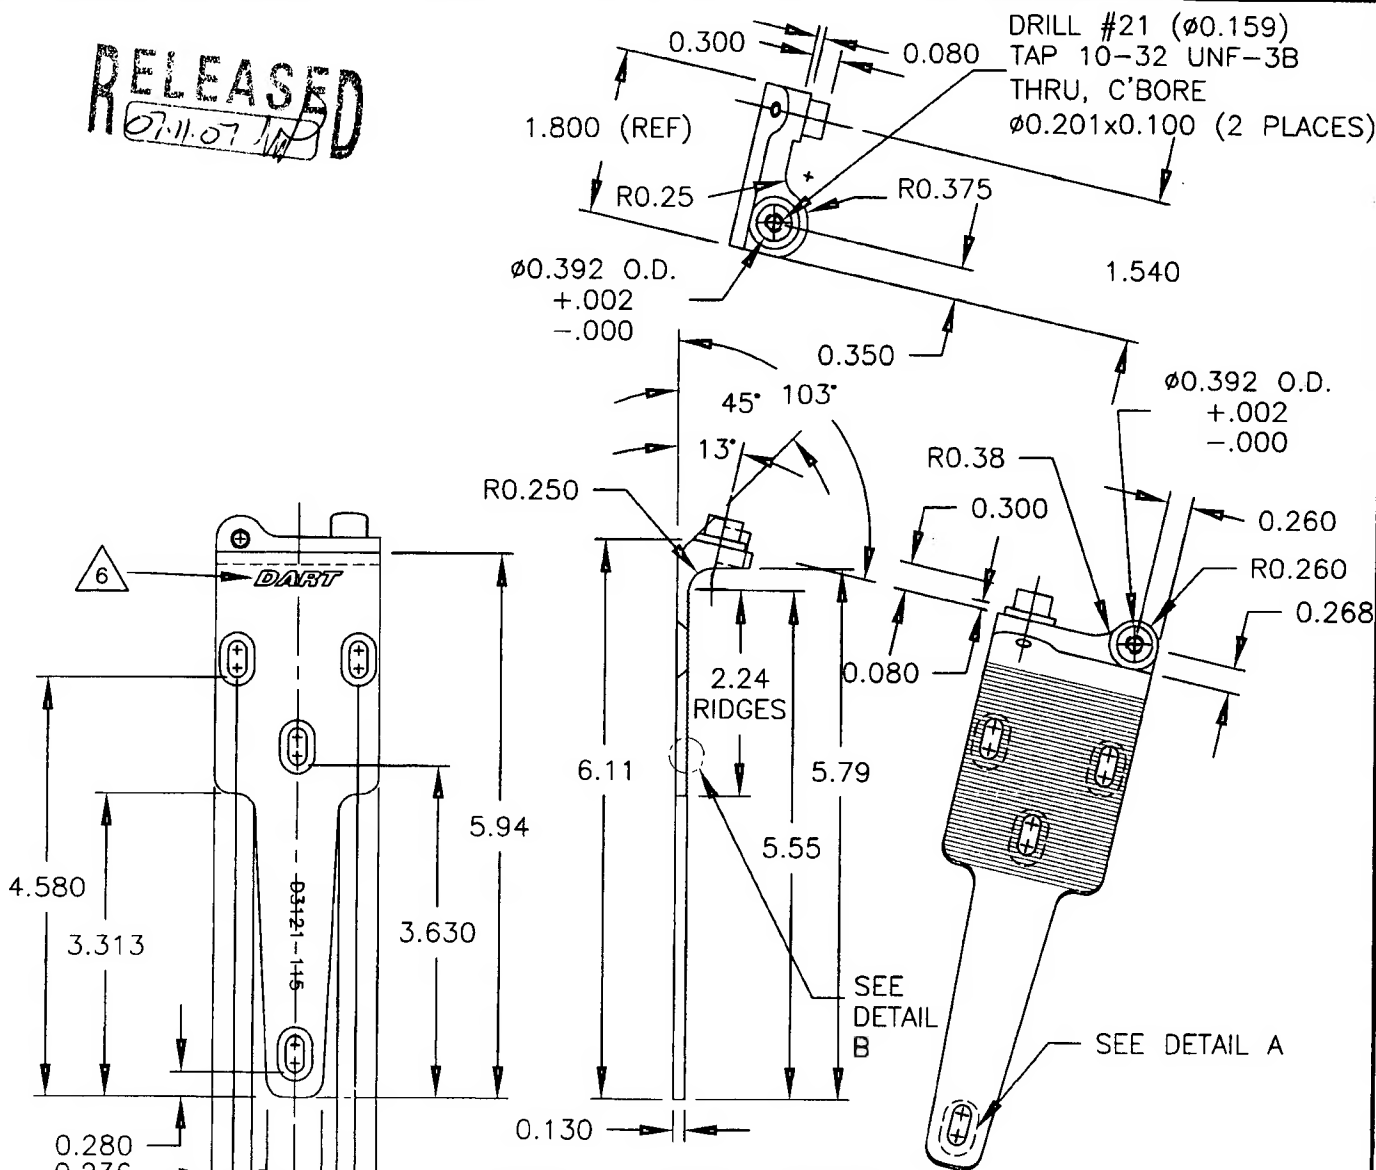

D3121-115 BRACKET (SHOWN)

D3121-116 BRACKET (OPPOSITE)

- 1) D3121-115 REPLACES PREMIER P/N B32-23001-15
D3121-116 REPLACES PREMIER P/N B32-23001-16
- 2) MATERIAL: 17-4 SS PER AMS 5604/5643
(REF DART SPEC. M17-4-B)
MIN ULTIMATE TENSILE STRENGTH = 150 ksi
MIN YIELD TENSILE STRENGTH = 100 ksi
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015
- 6) ENGRAVE DART P/N & LOGO IN AREAS SHOWN
- 7) HOLE IN SPIGOT TO BE CONCENTRIC WITHIN 0.005


Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

64855




DESIGN #	DRAWN BY LE	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D3121	REV. E SHEET 10 OF 10
DATE 07.11.07	TITLE BRACKET ASSEMBLY		SCALE 1:1

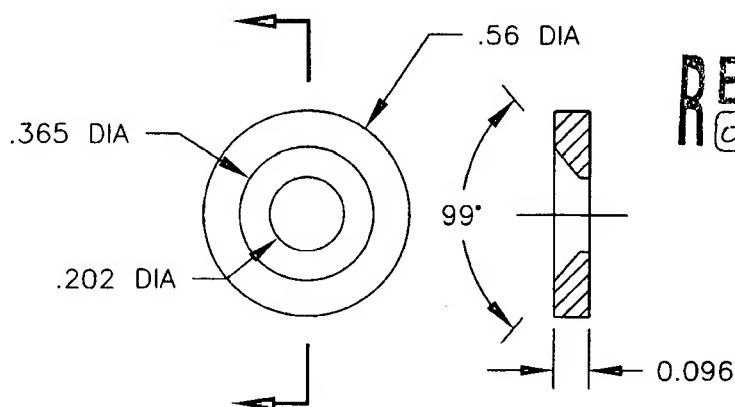


D3121-17 WASHER (SCALE 1:1)

- 1) REPLACES PREMIER P/N B32-23001-17
- 2) MATERIAL: AISI 303 SS ROUND BAR, ANNEALED (REF DART SPEC. M303R)
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

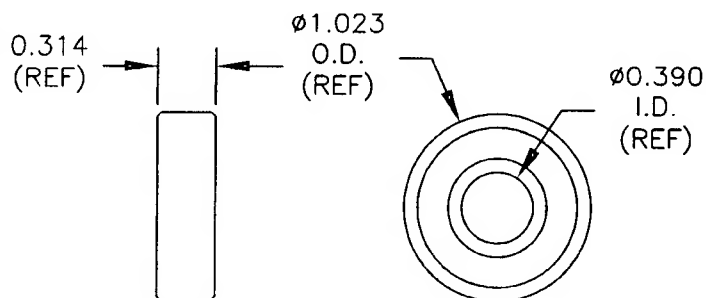


D3121-19 BEARING (SCALE 1:1)

- 1) POSSIBLE SUPPLIER: KING BEARING P/N 6000-2ZJ/EM FAFNIR P/N 9100KDD
- 2) ALL DIMENSIONS ARE IN INCHES

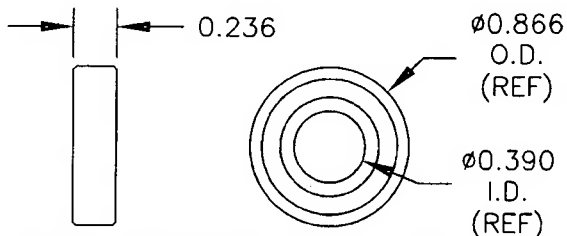


D3121-23 BEARING (SCALE 1:1)

- 1) POSSIBLE SUPPLIER: SKF P/N 61900-2Z OR KML P/N 6900-ZZ
- 2) ALL DIMENSIONS ARE IN INCHES

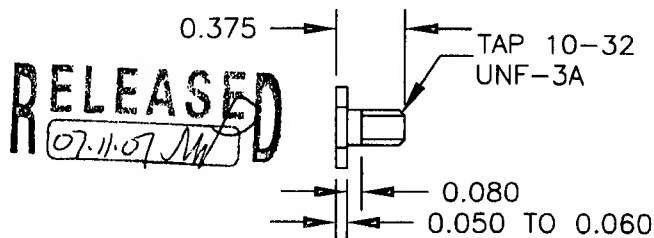


D3121-21 BOLT (SCALE 1:1)

- 1) MATERIAL: AISI 303 SS HEX, ANNEALED (REF DART SPEC. M303H0.500)
- 2) FINISH: NONE
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) BREAK ALL SHARP EDGES 0.005 TO 0.015

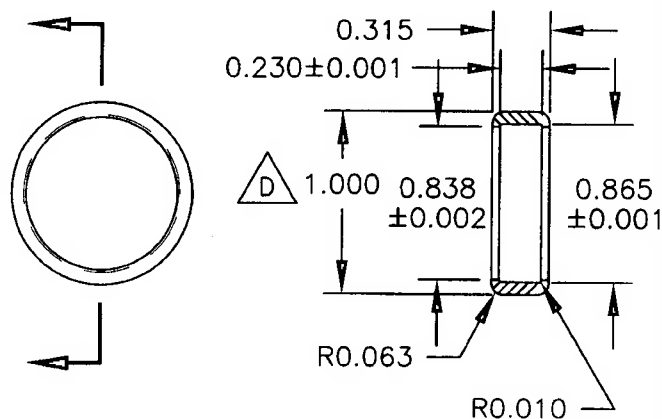

D3121-25 CAP (SCALE 1:1)

- 1) MATERIAL: DELRIN ROD, Ø1.25 (REF DART SPEC. M-DELIN-R1.250)
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) ALL DIMENSIONS ARE IN INCHES

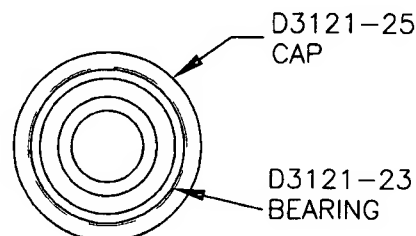

D3121-241 BEARING ASSEMBLY (SCALE 1:1)

Copyright © 2002 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

65855

DART AEROSPACE LTD		Work Order: 88859
Description: Bracket assy		Part Number: D3121-15
Inspection Dwg: D3121	Rev: E	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
1.800	+/- .010	1.802	✓		um	25-4
.300	"	.303	✓		"	
.080	"	.079	✓		"	
.392	+ .002/- .000	.393	✓		mic	25-1
1.540	+/- .010	1.545	✓		um	25-4
.350	"	.352	✓		"	
					"	
2.63	+/- .030	2.634	✓		"	
.317	+/- .010	.310	✓		"	
1.800	"	1.800	✓		"	
1.550	"	1.548	✓		"	
.900	"	.896	✓		"	
.250	"	.246	✓		"	
1.267	"	1.260	✓		"	
2.48	+/- .030	2.473	✓		"	
2.24	"	2.260	✓		"	
2.80	"	2.804	✓		"	
.130	+/- .010	.132	✓		"	

Measured by: RT	Audited by: B.A	Preliminary Approval:
Date: 12-08-10	Date: 12/08/13	Date:

Rev	Date	Change	Revised by	Approved
E	10.04.14	Added preliminary approval	KJ	

10.04.15

